



2024 Liberty Work Complete QC

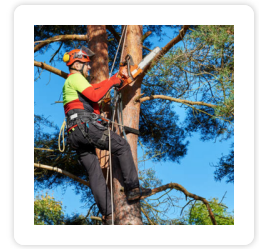

QC of work complete

4/10/2024, 3:34:50 PM UTC

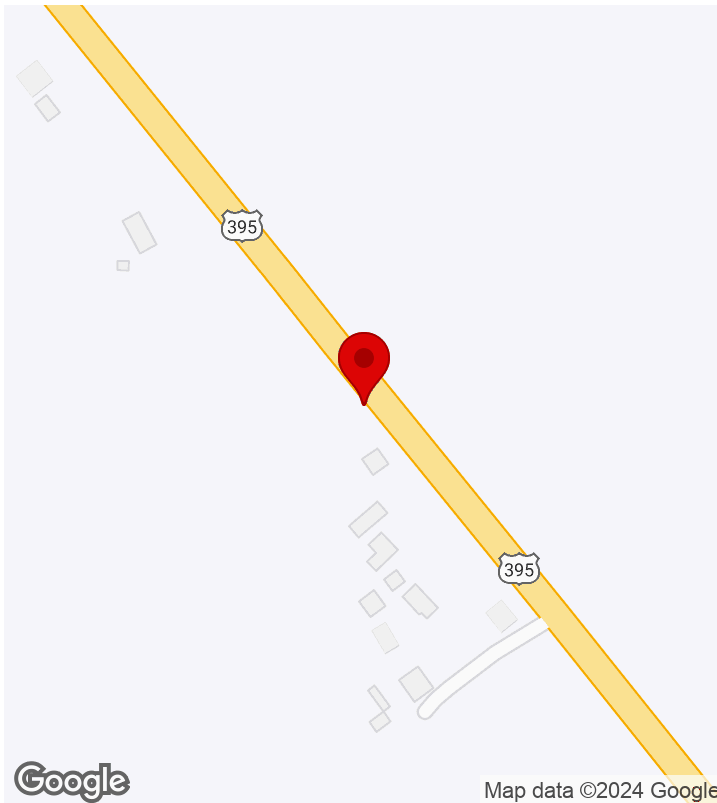

CREATED

🕒 4/1/2024, 8:17:00 PM UTC
👤 by Paul Kumro

UPDATED

🕒 4/10/2024, 3:34:50 PM UTC
👤 by Eric Oiler

STATUS

Corrective Action Completed

LOCATION

📍 38.519674, -119.484140



Map data ©2024 Google



QC Assessment Date | April 1, 2024

Tree Information

Tree_ID	
Work_Status	
Work_Order_Circuit	
Refusal	
Date_Created	
Modified_Date	
Section	
Time Entry Date Created	
Work_Order_Span_ID	
Physical_Address	
Pole_Number	
Quantity	
Time_Entry_Quantity	
Species	
Height	
DBH	
Defect_Type	
Location_Comments	
Q1 Work Not Performed	0
Work_Type	
Q2 MCD Not Achieved or Not as Prescribed	4
Q3 Will Not Hold	1
Q4 Potential Hazard Remain	0
Cleanup_Method	
Work_Order_Comments	
Q5 Site Clean	0
Q6 ANSI Not Achieved	3
Q7 Other Trees Affected by Removal	0
Q8 Site Condition Not Stable	0



Comments

OEIS tag says elm by pole 293672 has growth at 5 ft to conductors, but reactive tag was placed on different polygon. This span has tree wire. The elm at pole was recently worked and currently has 12 ft of clearance offset under conductors. There's a row of 4 elms midspan where reactive tag was placed that were recently worked, those elms did not achieve MCD and currently have growth at 6.5-11 ft offset under conductors. Elm furthest south in the group still has growth at 6.5 ft offset under conductors. Minor Stub cuts on 3 elms. Good TGR candidates since the only way to achieve MCD is to pollard these landscape trees.

4/9/24 4/9/24 Additional clearance achieved by tree crews, growth is now 12 below conductors. Additional photo added to show MCD achieved.



Photos



